



E2CY-SD

Proximity Sensor with Separate Amplifier Unit for Detection of Non-ferrous Metals with Simple Sensitivity Adjustment


- Detects aluminum, copper, and other non-ferrous metals.
- Product lineup includes compact, flat Sensor Head (E2CY-V3A) and model with fluororesin (E2CY-C2AF) for resistance to chemicals.
- Simple teaching function to easily adjust sensitivity.
- Check detection status at a glance with numeric values on a digital display.

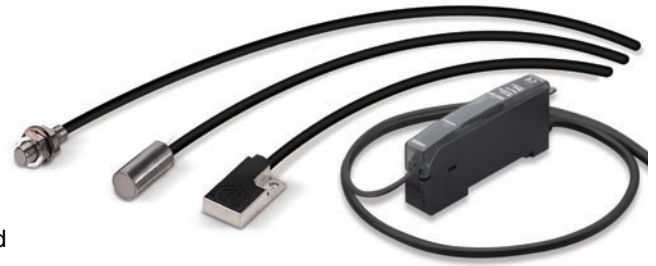

 Be sure to read *Safety Precautions* on page 6.

Ordering Information

Sensors [Refer to *Dimensions* on page 7.]

Appearance	Stable sensing distance	Model
 Shielded	M5	E2CY-X1R5A 3M
	5.4 dia.	E2CY-C1R5A-1 3M
	8 dia.	E2CY-C2A 3M
	Flat	E2CY-V3A 3M
	8 dia.	E2CY-C2AF 3M

Amplifier Units

Output configuration	Model
DC 3-wire NPN open collector	E2CY-SD11 2M

Note: The E2CY-C2AF has a fluororesin head. We also offer a model with a 5-m fluororesin cable. Specify the cable length at the end of the model number. (Example: E2CY-C2AF 5M)

E2CY-SD

Ratings and Specifications

Sensors

Item	Model	E2CY-X1R5A E2CY-C1R5A-1	E2CY-C2A(F)	E2CY-V3A
Stable sensing distance		0 to 1.5 mm	0 to 2 mm	0 to 3 mm
Differential travel		10% max. of sensing distance with Amplifier Unit in FINE mode 15% max. of sensing distance with Amplifier Unit in NORM mode		
Detectable object		Non-ferrous metal		
Standard sensing object		Aluminum: 8 × 8 × 1 mm	Aluminum: 12 × 12 × 1 mm	
Response frequency *1		40 Hz min. with Amplifier Unit in FINE mode 100 Hz min. with Amplifier Unit in NORM mode		
Ambient temperature range		Operating: -10 to 55°C, Storage: -25 to 70°C (with no icing or condensation)		
Ambient humidity range		Operating and Storage: 35% to 95% (with no condensation)		
Temperature influence *2	-10 to 55°C	±15% max. of sensing distance at 23°C	±10% max. of sensing distance at 23°C	±15% max. of sensing distance at 23°C
	0 to 40°C	±10% max. of sensing distance at 23°C *3		±10% max. of sensing distance at 23°C
Vibration resistance		Destruction: 10 to 500 Hz, 2-mm double amplitude or 150 m/s ² for 2 hours each in X, Y, and Z directions		
Shock resistance		Destruction: 500 m/s ² 3 times each in X, Y, and Z directions		
Degree of protection		IEC 60529 IP67		
Connection method		Pre-wired Models (High-frequency coaxial cable, Standard cable length: 3 m)		
Cable length compensation		0.5 to 5 m *4		
Weight (packed state)		Approx. 35 g		
Materials	Case	Stainless steel	Zinc die-cast	
	Sensing surface	Heat-resistant ABS (E2CY-C2AF: Fluororesin)		
	Cable	Soft PVC (E2CY-C2AF: Fluororesin)		
	Clamping nut	Nickel-plated brass (E2CY-X1R5A only)		
	Toothed washer	Zinc-plated iron (E2CY-X1R5A only)		
	Mounting screws	Zinc-plated iron (E2CY-V3A only)		

*1. The average value when using the DC-switching control output on the Amplifier Unit.
Measurement conditions are as follows: standard sensing object, a distance of twice the standard sensing object, and a set distance of half the stable sensing distance.

*2. When the temperature around the Amplifier Unit is stable at 23°C.

*3. E2CY-C1R5A-1: ±15% max. of sensing distance at 23°C

*4. When extending the cable, use a 1.5D-2V (equivalent to JIS C 3501) cable with characteristic impedance of 50 Ω.

Amplifier Units

Item	Model	E2CY-SD11
Power supply voltage		12 to 24 VDC ±10%, ripple: 10% max.
Power consumption		1,080 mW max. (45 mA max. at 24 VDC)
Sensing distance adjustment range		10% min. of stable sensing distance
Sensitivity setting		Teaching / manual adjustment
Control output		NPN open collector (26.4 VDC max.), load current: 100 mA max., residual voltage: 1 V max.
Functions	OFF-delay timer	0 to 40 ms (1 to 20 ms: 1-ms increments, 20 to 40 ms: 5-ms increments)
	Zero reset	Supported.
	Initial reset	Supported. (All settings are returned to their default values.)
	Hysteresis setting	3 to variable
	Self diagnosis	Displays errors (sensor disconnection, sensor short-circuit, or output short-circuit)
Operation mode		Changed with NO/NC switch.
Protection circuits		Power supply reverse polarity protection and output short-circuit protection
Indicator		Operation indicator (orange)
Digital display *1		Detection amount display (FINE: 4,000 max., NORM: 2,000 max.), bar display, function display (red)
Reverse display		Supported.
Ambient temperature range		Operating: -10 to 55°C, Storage: -25 to 70°C (with no icing or condensation)
Ambient humidity range		Operating and storage: 35% to 85% (with no condensation)
Temperature influence *2		±10% max. of sensing distance at 23°C in the temperature range of -10 to 55°C
Voltage influence		±1% max. of sensing distance in the rated voltage range ±10%
Insulation resistance		20 MΩ min. (at 500 VDC) between current-carrying parts and case
Dielectric strength		1,000 VAC, 50/60 Hz for 1 minute. between current-carrying parts and case
Vibration resistance		Destruction: 10 to 150 Hz, 1.5-mm double amplitude or 100 m/s ² for 2 hours each in X, Y, and Z directions
Shock resistance		Destruction: 300 m/s ² 3 times each in X, Y, and Z directions
Degree of protection		IEC 60529 IP50 (with Sensor cable connected and protective cover attached)
Connection method		Pre-wired Model (Standard cable length: 2 m)
Weight (packed state)		Approx. 100 g
Materials	Case	PBT
	Cover	Polycarbonate
	Cable connecting screws	Zinc-plated iron
Accessories		E39-L143 Mounting Bracket (SUS304 stainless steel), instruction manual

*1. If the Sensor approaches iron or other ferrous metals, the digital display will show negative values.


*2. When the temperature around the Sensor is stable at 23°C.

Note: You can mount the Amplifier Unit on a DIN Track without using the Mounting Bracket.


Engineering Data (Typical)

Sensing area


E2CY-X1R5A/E2CY-C1R5A-1

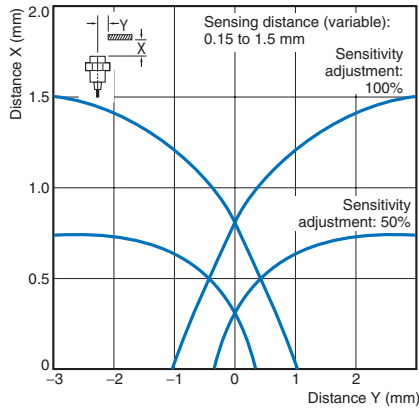

E2CY-C2A(F)

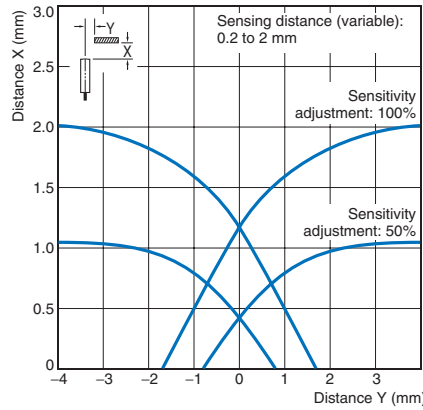


E2CY-V3A

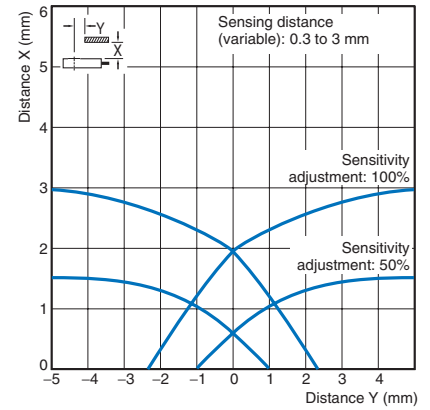


Influence of Sensing Object Size and Material


E2CY-X1R5A/E2CY-C1R5A-1

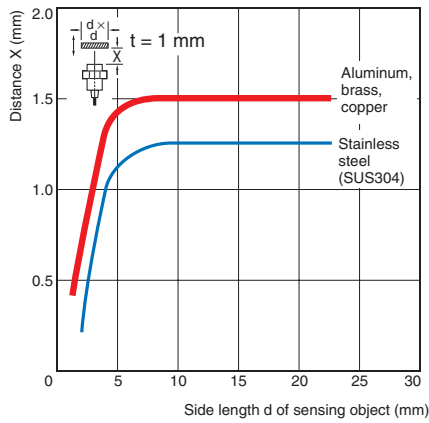

E2CY-C2A(F)

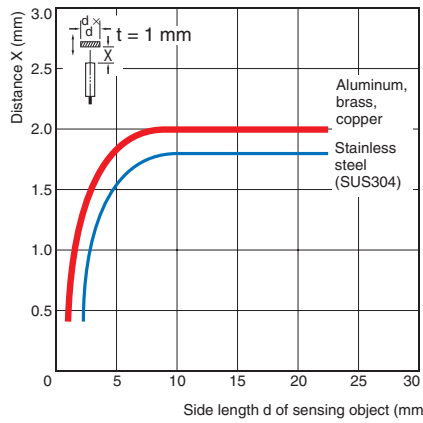


E2CY-V3A

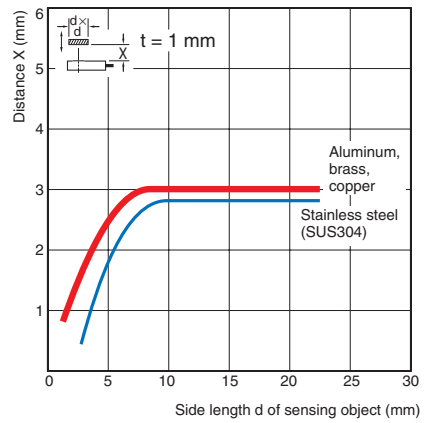


Temperature influence


E2CY-X1R5A/E2CY-C1R5A-1

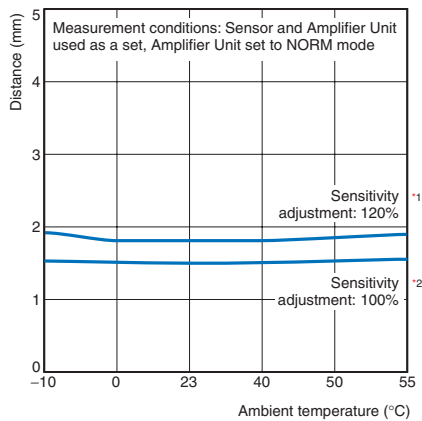

E2CY-C2A(F)

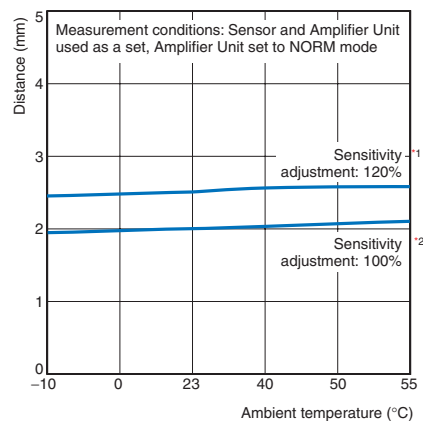

E2CY-V3A

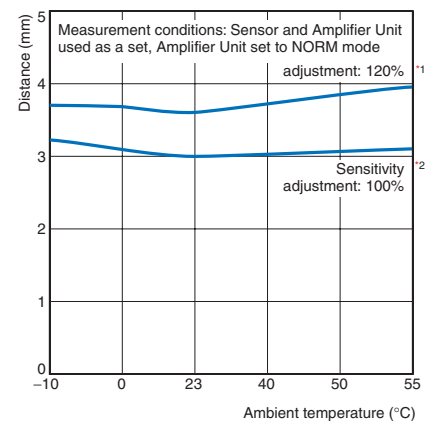


*1. When the set distance is the maximum stable sensing distance multiplied by 1.2 and at an ambient temperature 23°C.

*2. When the set distance is the maximum stable sensing distance and at an ambient temperature 23°C.


E2CY-SD

Sensing Distance Vs. Digital Display Value


E2CY-X1R5A/E2CY-C1R5A-1

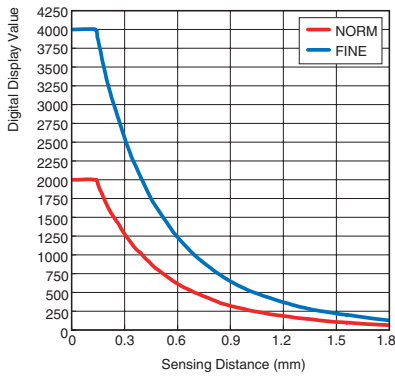

E2CY-C2A(F)

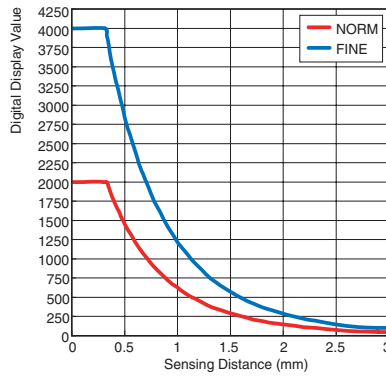



E2CY-V3A

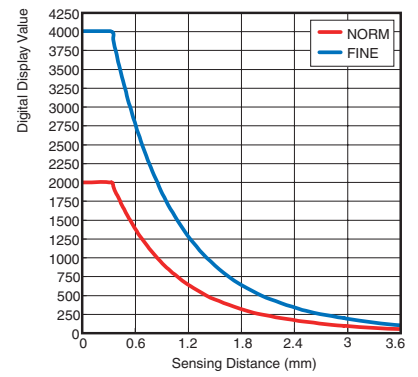

I/O Circuit Diagrams


Operation mode	Timing Chart	Output circuit
NO	<p>Sensing object Present: [Green bar]</p> <p>Sensing object Not present: [White bar]</p> <p>Output transistor ON: [Green bar]</p> <p>Output transistor OFF: [White bar]</p> <p>Amplifier Unit ON: [Green bar]</p> <p>Amplifier Unit OFF: [White bar]</p> <p>Operation indicator (orange) ON: [Green bar]</p> <p>Operation indicator (orange) OFF: [White bar]</p>	
NC	<p>Sensing object Present: [Green bar]</p> <p>Sensing object Not present: [White bar]</p> <p>Output transistor ON: [White bar]</p> <p>Output transistor OFF: [Green bar]</p> <p>Amplifier Unit ON: [White bar]</p> <p>Amplifier Unit OFF: [Green bar]</p> <p>Operation indicator (orange) ON: [White bar]</p> <p>Operation indicator (orange) OFF: [Green bar]</p>	

Connection

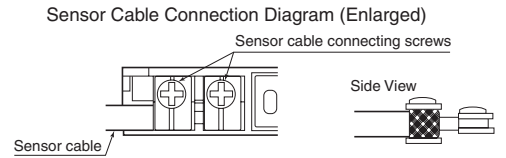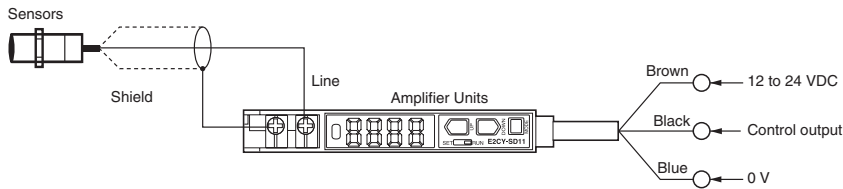

Nomenclature

Amplifier Units

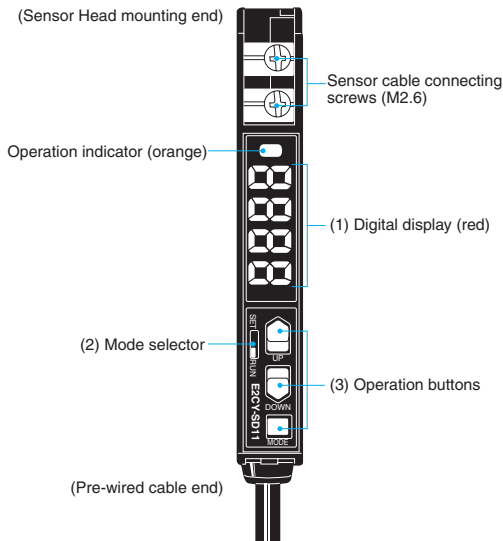

(1) Digital Display

The digital display shows information such as the detection amount or the current function name.

(2) Mode Selector

The mode selector is used to switch between modes.

Mode	Description
SET	Select this mode to set detection conditions, perform teaching, or to initialize settings to their default values.
RUN	Select this mode to perform actual sensing operation or to perform the following functions. <ul style="list-style-type: none"> Manually adjusting the threshold Checking the current threshold value Zero reset Locking button operation

(3) Operation Buttons

Use these buttons to change the display or to change the function settings. Button functions depend on the current mode.

Button	SET Mode	RUN Mode
UP Button 	Changes the function in the forward direction. Changes the set value in the forward direction. Performs positioning teaching.	Increases the threshold value.
DOWN Button 	Changes the function in the reverse direction. Changes the set value in the reverse direction. Performs teaching without a workpiece.	Decreases the threshold value.
MODE Button 	Selects the function. Selects the set value.	Checks the current threshold value. Performs a zero reset.

The following table lists the available functions.

Function	Set value	Description
		Change function: UP/DOWN Buttons Change set value: UP/DOWN Buttons Select function: MODE Button Select set value: MODE Button
<i>tEc h</i>	Sensing threshold value	Performs the following types of teaching: <ul style="list-style-type: none"> Teaching without a workpiece Positioning teaching Teaching with/without a workpiece
1- <i>o p</i>	NO/NC	Changes the operation mode. <ul style="list-style-type: none"> NO (normally open): Turn output ON when an object is detected. NC (normally close): Turn output ON when no object is detected.
2- <i>fn</i>	NORM/FINE	Changes sensor precision. <ul style="list-style-type: none"> NORM: Standard * FINE: High precision
3- <i>tf</i>	0 to 40ms	Changes the OFF-delay time. Sets a delay between 0 to 20 ms in increments of 1 ms. Sets a delay between 20 to 40 ms in increments of 5 ms.
4- <i>dp</i>	Value/segment bar	Changes the detection amount display.
5- <i>rw</i>	Normal or reverse	Changes the display direction. <ul style="list-style-type: none"> Normal: The Sensor is connected to the left end. Reverse: The Sensor is connected to the right end.
6- <i>hy</i>	3 to variable	Changes the hysteresis width.

* FINE Mode enables you to perform measurements at twice the step of NORM Mode. However, this results in a slower response.

E2CY-SD

Safety Precautions

Refer to *Warranty and Limitations of Liability*.

⚠ WARNING

This product is not designed or rated for ensuring safety of persons either directly or indirectly. Do not use it for such purposes.




Precautions for Correct Use

Do not use the product under ambient conditions that exceed the ratings.

● Design

Influence of Surrounding Metal


When mounting the Sensor within a metal panel, ensure that the clearances given in the following table are maintained. Failure to maintain these distances may cause deterioration in the performance of the Sensor.

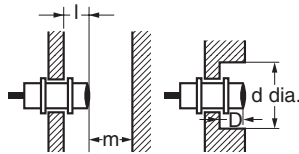

Influence of Surrounding Metal (Unit: mm)

Model	Item	l	d	D	m
E2CY-X1R5A	0	0	5	0	9
E2CY-C1R5A-1			5.4		
E2CY-C2A(F)			8		
E2CY-V3A			12		

The E2CY-V3A can be embedded in metal with the sensing surface at the same level as the metal surface.




Mutual Interference

When installing Sensors face-to-face or side-by-side, ensure that the minimum distances given in the following table are maintained.

Mutual Interference (Unit: mm)

Model	Item	A	B
E2CY-X1R5A	20	15	15
E2CY-C1R5A-1			
E2CY-C2A(F)			
E2CY-V3A	30	12	

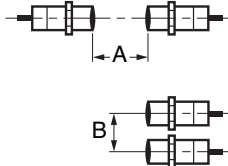


Effects of a High-frequency Electromagnetic Field

If the Sensor is located near a device that generates high frequencies or a transceiver, it may be affected by such a device and malfunctions may occur.

● Mounting

- Do not use excessive force when tightening the nuts on the E2CY-X1R5A. A toothed washer must be used with the nut.




Model	Torque
E2CY-X1R5A	0.98 N·m

Note: The above leeways in tighten torque assume that a toothed washer is being used.

- Mounting Unthreaded Cylindrical Models

When using a set screw, tighten it to a torque of 0.2 N·m max.

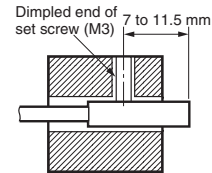

- Do not tighten the mounting screw for the E2CY-V3A with excessive force. Always use a washer when tightening the mounting screw.

Model	Torque
E2CY-V3A	0.15 N·m

● Adjustment

Power ON

The E2CY requires a minimum of 200 ms from the time the power supply is turned ON before it can begin detection. Do not remove the Sensor Head while the power supply is turned ON. If the E2CY-SD11 and load are connected to separate power supplies, always turn ON the power supply to the E2CY-SD11 first.

Power OFF


Output pulses may occur when the power supply is turned OFF. Turn OFF the power supply to the load or load line first.

Teaching

Make sure that the Sensor is in operating condition before making sensitivity adjustments.

Processing the Sensor Cable Ends

When cutting or extending the cable, the end of the Sensor cable connected to the E2CY-□ must be processed as shown in the following illustration.

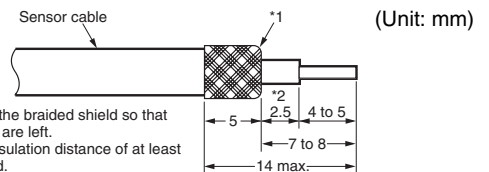

- *1. Be sure to turn over the braided shield so that none of its thin wires are left.
- *2. Make sure that an insulation distance of at least 2.5 mm is maintained.

The length compensation range for cutting or extending the cable is 0.5 to 5 m. When extending the cable, use a 1.5D-2V (equivalent to JIS C 3501) cable with characteristic impedance of 50 Ω.

Amplifier Unit Cable Extension

Do not extend the cable to more than 30 m. Use a cable of 0.3 mm² or greater for extensions.

Dimensions

Tolerance class IT16 applies to dimensions in this data sheet unless otherwise specified.

Sensors

<p>E2CY-X1R5A</p>	<p>E2CY-C1R5A-1</p>
<p>E2CY-C2A(F)</p>	<p>E2CY-V3A</p>


Amplifier Units

E2CY-SD11


* The dimension to the digital display surface is 29.3 mm, and the dimension to the operation button surface is 29.8 mm.
Note: You can mount the Amplifier Unit on a DIN Track without using the Mounting Bracket.

Cable Bending Start Position and Minimum Bending Radius

Sensors

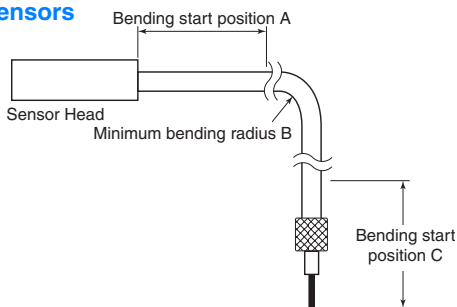

Amplifier Units

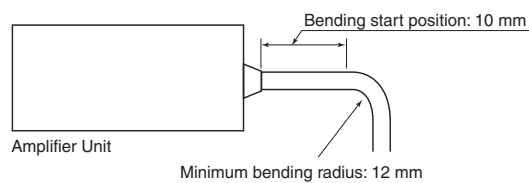

(Unit: mm)

Model	Item	A	B	C
E2CY-X1R5A		15	25	35
E2CY-C1R5A-1				
E2CY-C2A				
E2CY-C2AF	30	35		
E2CY-V3A	15	25		

READ AND UNDERSTAND THIS DOCUMENT

Please read and understand this document before using the products. Please consult your OMRON representative if you have any questions or comments.

WARRANTY

OMRON's exclusive warranty is that the products are free from defects in materials and workmanship for a period of one year (or other period if specified) from date of sale by OMRON.

OMRON MAKES NO WARRANTY OR REPRESENTATION, EXPRESS OR IMPLIED, REGARDING NON-INFRINGEMENT, MERCHANTABILITY, OR FITNESS FOR PARTICULAR PURPOSE OF THE PRODUCTS. ANY BUYER OR USER ACKNOWLEDGES THAT THE BUYER OR USER ALONE HAS DETERMINED THAT THE PRODUCTS WILL SUITABLY MEET THE REQUIREMENTS OF THEIR INTENDED USE. OMRON DISCLAIMS ALL OTHER WARRANTIES, EXPRESS OR IMPLIED.

LIMITATIONS OF LIABILITY

OMRON SHALL NOT BE RESPONSIBLE FOR SPECIAL, INDIRECT, OR CONSEQUENTIAL DAMAGES, LOSS OF PROFITS OR COMMERCIAL LOSS IN ANY WAY CONNECTED WITH THE PRODUCTS, WHETHER SUCH CLAIM IS BASED ON CONTRACT, WARRANTY, NEGLIGENCE, OR STRICT LIABILITY.

In no event shall responsibility of OMRON for any act exceed the individual price of the product on which liability is asserted.

IN NO EVENT SHALL OMRON BE RESPONSIBLE FOR WARRANTY, REPAIR, OR OTHER CLAIMS REGARDING THE PRODUCTS UNLESS OMRON'S ANALYSIS CONFIRMS THAT THE PRODUCTS WERE PROPERLY HANDLED, STORED, INSTALLED, AND MAINTAINED AND NOT SUBJECT TO CONTAMINATION, ABUSE, MISUSE, OR INAPPROPRIATE MODIFICATION OR REPAIR.

SUITABILITY FOR USE

THE PRODUCTS CONTAINED IN THIS DOCUMENT ARE NOT SAFETY RATED. THEY ARE NOT DESIGNED OR RATED FOR ENSURING SAFETY OF PERSONS, AND SHOULD NOT BE RELIED UPON AS A SAFETY COMPONENT OR PROTECTIVE DEVICE FOR SUCH PURPOSES. Please refer to separate catalogs for OMRON's safety rated products.

OMRON shall not be responsible for conformity with any standards, codes, or regulations that apply to the combination of products in the customer's application or use of the product.

At the customer's request, OMRON will provide applicable third party certification documents identifying ratings and limitations of use that apply to the products. This information by itself is not sufficient for a complete determination of the suitability of the products in combination with the end product, machine, system, or other application or use.

The following are some examples of applications for which particular attention must be given. This is not intended to be an exhaustive list of all possible uses of the products, nor is it intended to imply that the uses listed may be suitable for the products:

- Outdoor use, uses involving potential chemical contamination or electrical interference, or conditions or uses not described in this document.
- Nuclear energy control systems, combustion systems, railroad systems, aviation systems, medical equipment, amusement machines, vehicles, safety equipment, and installations subject to separate industry or government regulations.
- Systems, machines, and equipment that could present a risk to life or property.

Please know and observe all prohibitions of use applicable to the products.

NEVER USE THE PRODUCTS FOR AN APPLICATION INVOLVING SERIOUS RISK TO LIFE OR PROPERTY WITHOUT ENSURING THAT THE SYSTEM AS A WHOLE HAS BEEN DESIGNED TO ADDRESS THE RISKS, AND THAT THE OMRON PRODUCT IS PROPERLY RATED AND INSTALLED FOR THE INTENDED USE WITHIN THE OVERALL EQUIPMENT OR SYSTEM.

PERFORMANCE DATA

Performance data given in this document is provided as a guide for the user in determining suitability and does not constitute a warranty. It may represent the result of OMRON's test conditions, and the users must correlate it to actual application requirements. Actual performance is subject to the OMRON Warranty and Limitations of Liability.

CHANGE IN SPECIFICATIONS

Product specifications and accessories may be changed at any time based on improvements and other reasons.

It is our practice to change model numbers when published ratings or features are changed, or when significant construction changes are made. However, some specifications of the product may be changed without any notice. When in doubt, special model numbers may be assigned to fix or establish key specifications for your application on your request. Please consult with your OMRON representative at any time to confirm actual specifications of purchased products.

DIMENSIONS AND WEIGHTS

Dimensions and weights are nominal and are not to be used for manufacturing purposes, even when tolerances are shown.

ERRORS AND OMISSIONS

The information in this document has been carefully checked and is believed to be accurate; however, no responsibility is assumed for clerical, typographical, or proofreading errors, or omissions.

PROGRAMMABLE PRODUCTS

OMRON shall not be responsible for the user's programming of a programmable product, or any consequence thereof.

COPYRIGHT AND COPY PERMISSION

This document shall not be copied for sales or promotions without permission.

This document is protected by copyright and is intended solely for use in conjunction with the product. Please notify us before copying or reproducing this document in any manner, for any other purpose. If copying or transmitting this document to another, please copy or transmit it in its entirety.

OMRON Corporation Industrial Automation Company
Tokyo, JAPAN

Contact: www.ia.omron.com

Regional Headquarters

OMRON EUROPE B.V.

Wegalaan 67-69-2132 JD Hoofddorp
The Netherlands
Tel: (31)2356-81-300/Fax: (31)2356-81-388

OMRON SCIENTIFIC TECHNOLOGIES INC.

6550 Dumbarton Circle,
Fremont, CA 94555-3605 U.S.A.
Tel: (1) 510-608-3400/Fax: (1) 510-744-1442

OMRON ASIA PACIFIC PTE. LTD.

No. 438A Alexandra Road # 05-05/08 (Lobby 2),
Alexandra Technopark,
Singapore 119967
Tel: (65) 6835-3011/Fax: (65) 6835-2711

OMRON (CHINA) CO., LTD.

Room 2211, Bank of China Tower,
200 Yin Cheng Zhong Road,
PuDong New Area, Shanghai, 200120, China
Tel: (86) 21-5037-2222/Fax: (86) 21-5037-2200

Authorized Distributor:

© OMRON Corporation 2011 All Rights Reserved.
In the interest of product improvement,
specifications are subject to change without notice.

CSM_2_1_1211
Cat. No. D112-E1-01

Printed in Japan
0811 (0811) (W)